# **IP-69K Stainless Steel AC Worm Gearmotors**

Most stainless steel gearmotors are rated IP-66 or higher, and are typically hermetically sealed to prevent water or particle ingress from frequent high-pressure washdowns. The IP-69K rating is defined via two industry standards: **IEC 60529**, *Degrees of Protection Provided by Enclosures*, which defines IP69 as, 6 = dust tight and 9 = high pressure water jet resistant.

The second standard is **ISO 20653**: for Road Vehicles – Degrees of Protection (IP Code) – Protection of Electrical Equipment Against Foreign Objects, Water and Access. **IP-69K** rated gearmotors are ideal for production conditions in the food and beverage industry, pharmaceutical industry, and in permanently wet environments.


# **IP-69K Specifications**

- Cover electrical equipment enclosures mounted to road vehicles
- Requires that the water jet pressure be measured during the test.
- The distance from the water nozzle to the motor is a minimum of 100mm min
- The maximum water jet temperature for both tests is 85±5°C (176°F).

#### **Alternative Terminal Box Positions**

Many IP-69K gearmotors allow the user the reposition the terminal box by rotating the motor in 90 degree increments as shown below. The standard terminal box orientation for Bodine stainless steel gearmotors is the 12 o'clock position.<sup>1</sup>


Figure 2 Alternative Terminal Box Positions

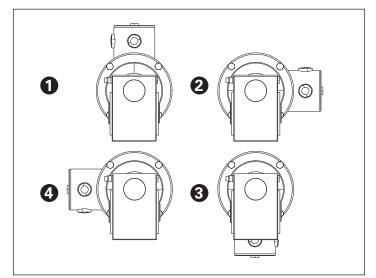

 For Bodine 56R1-50JW/H stainless steel gearmotors, the motor or gearhead can be repositioned in 90° increments. Four 3/8-16 .75 long hex head screws connect the motor to the gearhead. Tighten the hex head screws to 20-25 ft-lb.



Figure 1 Ingress Protection Rating

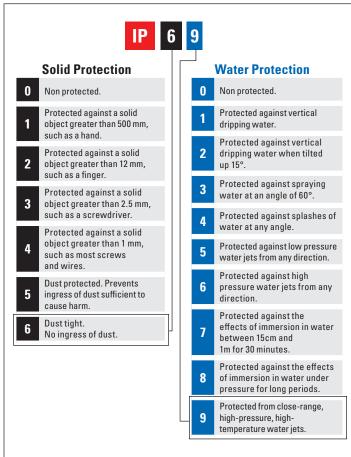

# APPLICATION NOTE

### Mounting an IP-69K Gearmotor

- Universal horizontal mounting for IP-69K gearmotors is shown in Figure 3.
- Other horizontal positions: the vent plug must always be either above or in line with the output shaft centerline.
   Exchange the vent plug with the one of the other threaded plugs on the gearbox as shown in Figure 3.
- Vertical mounting positions: To mount the gearmotor so that
  the shaft is oriented vertically, make sure that the vent plug is
  at the top of the gearbox face as shown in Figure 4.

Figure 4 Vertical Shaft Mounting Positions


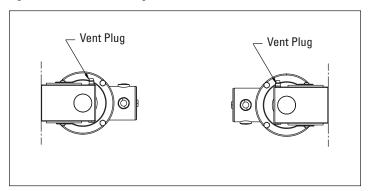


Figure 3 Horizontal Shaft Mounting Positions

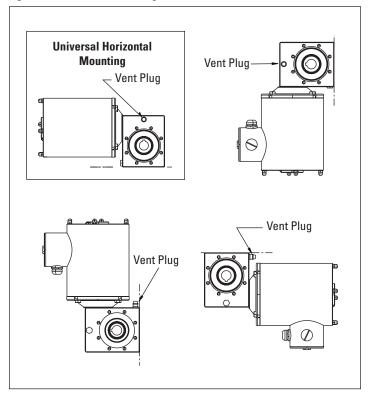

### Wiring an IP-69K Gearmotor

Use a heavy-duty power cable rated SJOW or SJT with diameter of .275 to .492 inches.

#### Mounting an IP-69K Gearmotor with a Torque Arm

A torque arm allows the gearmotor to self-align with the conveyor belt drive shaft.

As shown in **Figure 5** the torque arm is mounted to the face-mount holes, and allows the gearmotor to float on the shaft. The key benefit of this mounting method is that it eliminates the risk of gearmotor shaft misalignment. This mounting configuration prevents bearing failures on the conveyor or gearhead and it reduces the risk of shaft fatigue fractures.

Figure 5 Typical Mounting Configuration with a Torque Arm

